



## Release Note

Software Version: 2.12.18.15

Models: V61W/V61G/V62W/V62G

Date: 2024.11.28



# Content

---

- Content** ..... 2
- 1 Revise History** ..... 3
- 2 Release 2.12.18.15** ..... 4
  - 2.1 New Features ..... 4
  - 2.2 Optimization ..... 4
  - 2.3 Bug Fix ..... 4
  - 2.4 New Features Description ..... 5

## 1 Revise History

---

No.	Version	Release Time
1	2.12.18.15	2024.11.28

## 2 Release 2.12.18.15

---

Models	Software Version	Comment
V61W/V61G/V62W/V62G	2.12.18.15	

### 2.1 New Features

1. Add Kazakh language
2. Add built-in background image resources
3. Added custom Dsskey background transparency feature
4. Add Chinese input method functionality
5. Added custom length function for sidekeys

### 2.2 Optimization

1. Optimize time zones and add Taipei as a new option.
2. Optimize LCD screen to customize scrolling display content
3. Optimize the interface hierarchy of the phone book to resolve flickering issues upon entry.
4. Optimize standby time display
5. Optimize the function of the page-flipping keys to flash when BLF is active on other pages.
6. Optimize the ringtone effect for incoming calls
7. Optimize the display length of side keys

### 2.3 Bug Fix

1. Fix issues related to abnormal volume adjustment during standby mode and after hands-free calls

Fanvil Technology Co., Ltd

Add: 10F, Block A, Dualshine Global Science Innovation Center, Honglang North 2nd Road, Bao'An District, Shenzhen, China  
Tel: +86-755-2640-2199 Fax: +86-755-2640-2618 Email: support@fanvil.com www.fanvil.com


2. Fix the issue where the search function of the XML cloud phone book does not follow alphabetical order.
3. Fix the issue where the dialer can only display up to 9 digits when selecting Persian.
4. Fix the issue where the input method selection on the LCD displays incorrect characters when selecting Persian
5. Fix the issue where the phone cannot obtain an IP address after connecting to Wi-Fi
6. Fix the issue where 'No service' is displayed in the upper left corner when the phone is in standby mode and not registered.

## 2.4 New Features Description

1. Add built-in background image resources


**Feature Description:** The phone supports more background images

**Implementation Details:** Go to the phone webpage - [System] - [Upgrade] - [Background List] to set up, click on Settings to apply on the phone.

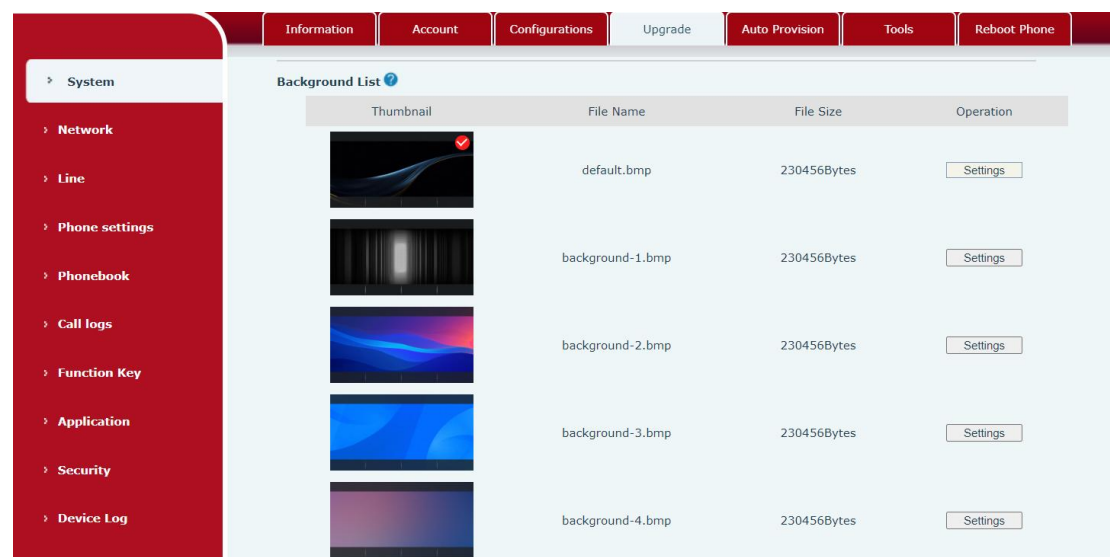


## 2. Added custom Dsskey background transparency feature

**Feature Description:** The phone supports setting the transparency of the side buttons on the standby desktop.

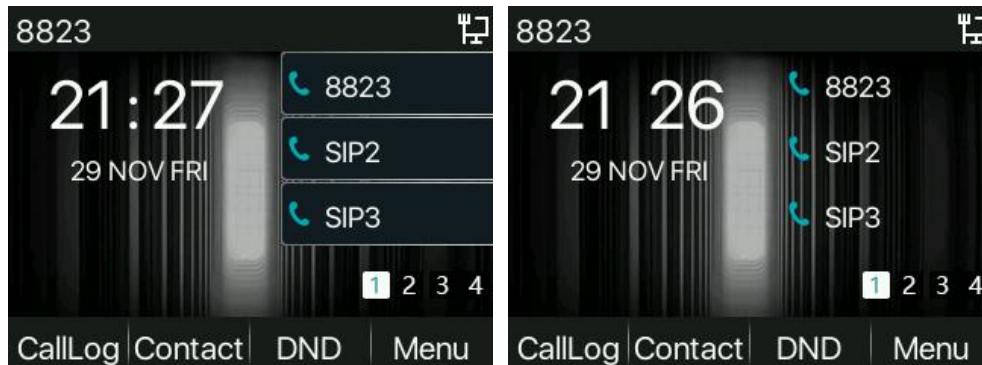


**Implementation Details:** Go to the phone webpage - [Phone Settings] - [Advanced] - [UI Preference] to configure it. When set to 0%, the side key border is opaque, and when set to 100%, the side key border is completely transparent

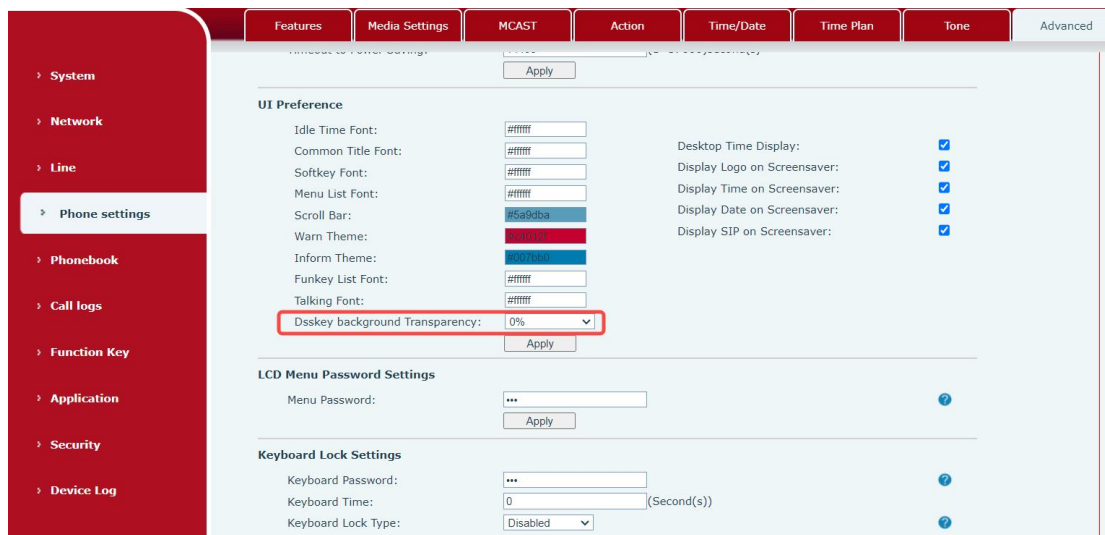


## 3. Added custom length function for side keys

**Feature Description:** The phone supports setting the length of side keys for clearer display of line information and other content.

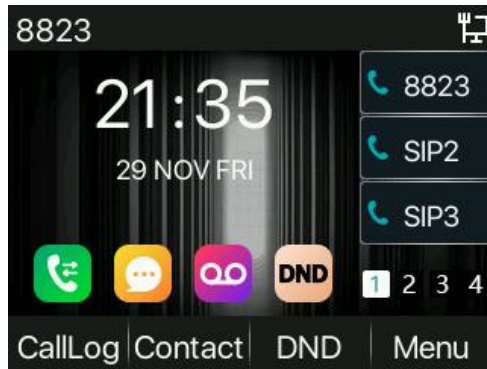

(Side key: default)

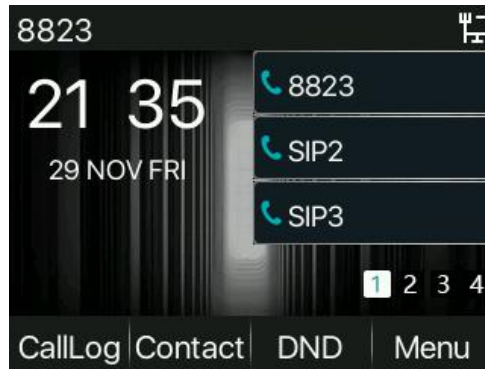

(Side key: long)

**Implementation Details:** Go to the phone webpage - [Function Key ] - [Side key] to set the length of the side keys

